



**Vehicle:** 2014-2016 Cadillac ATS, 2015-2016 Cadillac Escalade, 2015-2016 Chevrolet Suburban/Tahoe, 2015-2016 GMC Yukon

**GM #:** 16-NA-061

**Problem:** Tire Pressures may not display and/or “Service TPMS” or “No Fob Detected” messages may appear.

**Solution:** Dealership will check the three Remote Control Door Lock Receiver module connections.



**Vehicle:** BMW models produced from 3/2014 to 1/2016 that use Continental TPMS sensors.

**BMW #:** SI-B36-01-15

**Problem:** A TPM Failure message displays on instrument cluster along with DTC's related to sensor signal reception.



**Solution:** Dealership will replace the remote control unit used by the TPM System.

## Honda/Acura Noise Reducing Wheels

Certain Honda and Acura vehicles are equipped with Noise Reducing Wheels. Attached to the wheel barrel are four plastic resonators that help reduce the mid-frequency noise caused by the tire coming in contact with the road while in motion.

Tire service procedures are the same as a normal wheel but if any of the resonators are loose or damaged, the entire wheel will need to be replaced.

Noise Reducing Wheels can be found on models with Direct or Indirect TPMS.

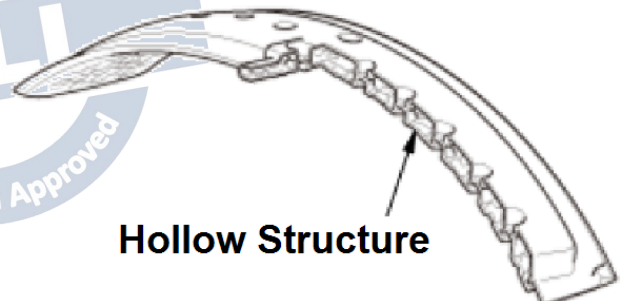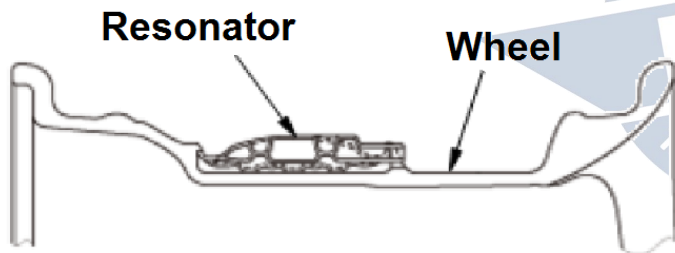

Dill Air Controls Products 1-800-815-DILL (3455)

[www.dillvalves.com](http://www.dillvalves.com)